

Mounting instruction

AIRCELL®5

N-Connector, crimp / item. No.: 7701




1 Cut off cable tail right-angled. Move the crimp-cover over the cable head. Cut off 16 mm of the outer sheathing with a knife.




2 Bend copper braid upwards right-angled.



3 Slit slightly a length of 8 mm of the copper foil and remove it.

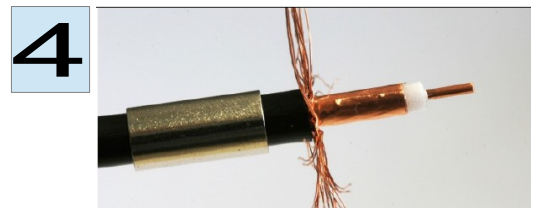

4 Remove 6 mm of the dielectric.

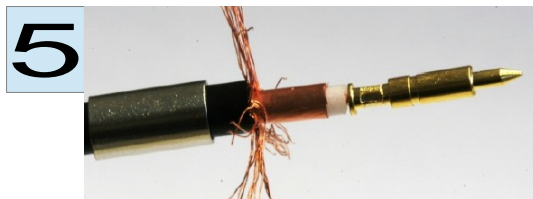

5 Put the head pin onto the inner conductor and solder/crimp it. (Use a Crimping Tool with Hex .068")



6 Insert the prepared cable end into the connector housing as far as it will go (Click).



7 Cut off the copper braid with a side cutter and move the crimp jacket to the front.



8 Crimp the crimp jacket with a crimp tool Hex .213"; herewith the copper braid will be trapped between the crimp jacket and the connector housing.