


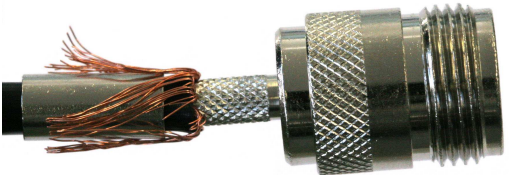






Mounting instruction



AIRCELL®5

N-RP-Socket, crimp/solder / Art. No. 7711

 <p>1. Cut off cable tail right-angled. Move the crimp sleeve over the cable tail.</p>	 <p>5. Put the inner pin onto the inner conductor and solder it.</p>
 <p>2. Remove 14 mm of the outer sheathing with a knife.</p>	 <p>6. Insert the so prepared cable end into the connector housing as far it goes (click).</p>
 <p>3. Bend copper braid upwards right-angled.</p>	 <p>7. Cut off the copper braid and move the crimp sleeve forward.</p>
 <p>4. Remove 6mm of the copper foil and 4mm of the foamed dielectric.</p>	 <p>8. Crimp the crimp sleeve with a crimp tool; herewith the copper braid will be clamped between the socket housing and the crimp sleeve.</p>