

Mounting instructions



AIRCELL®5

SMA-Connector male (crimp/solder) / item. no.: 7



1 Cut the cable end at right angles. Push the crimp sleeve over the cable end. Remove 11 mm of the outer mantle with the knife.



2 Twist the copper braid at right angles. With a knife scratch 3 mm of the copper foil and Foamed dielectric and remove.



3 Place the inner pin on the conductor and solder it through the hole. Then use a knife to scratch and remove 2 mm of the copper foil. Insert the cable end so prepared into the connector housing as far as it will go.



4 Insert the end of the cable thus prepared up to the Stop (click) in the connector housing.



5 Cut off the copper braid with the side cutter and move the crimp sleeve forward.



6 Crimp the crimping sleeve with the crimping pliers so that the copper braid is clamped between the plug housing and the crimp sleeve.