







Mounting instruction



AIRCELL®5

SMA-RP-Connector, crimp/solder / Art. No. 7755

 <p>1. Cut off cable tail right-angled. Move the crimp sleeve over the cable tail.</p>	 <p>4. Remove 2mm of the foamed dielectric.</p>
 <p>2. Remove 12mm of the outer sheathing with a knife. Bend copper braid upwards right-angled.</p>	 <p>5. Put the inner pin onto the inner conductor and solder it.</p>
 <p>3. Remove 4mm of the copper foil with a knife.</p>	 <p>6. Insert the so prepared cable end into the connector housing as far it goes (click). Cut off the copper braid and move the crimp sleeve forward. Crimp the crimp sleeve with a crimp tool; herewith the copper braid will be clamped between the socket housing and the crimp sleeve.</p>