Mounting instruction

Ecoflex[®] 10, Aircom[®] Premium

UHF plug / Item no.: 7377



		$\overline{}$		
Required tools:			1	
1 x	cutter knife		L	
1 x	scissors			
1 x	soldering station	C	Cut o	off cabl
1 x	solder			jacket

Cut off cable tail right-angled. Remove 26 mm of the outer jacket with a knife.

2

Shorten the copper braid to 10 mm.

3

Bend the copper braid back, score the copper foil with a cutter knife and remove it completely.

4

Remove 16 mm of the white dielectric.



Slide the connector sleeve over the cable. Screw the connector housing onto the cable end.

6

Carefully solder the inner conductor from the front.



Screw the connector sleeve onto the connector housing.