

Mounting instructions



AIRCELL® 7

TNC-Plug, crimp/solder Item. No.: 7374

Required tools:

- 1 x Cutter knife
- 1 x scissors
- 1 x soldering iron/ station
- 1 x Crimping pliers, crimping insert size .324 or .315



1 Cut off cable tail right-angled. Move the crimp-cover and the cable sleeve over the cable head.



2 Remove 12 mm of the outer sheath with the cutter knife.



3 Bend the copper mesh at a right angles. Remove 5 mm of the copper foil with the cutter.



4 Solder the inner conductor to the center contact or crimp it with .1 or 0.096.



5 Push the cable end prepared in this way into the connector housing as far as it will go. Bend the copper braid forward and cut with scissors. Then push the crimp barrel forward.



6 Crimp the crimp jacket with a crimp tool; herewith the copper braid will be trapped between the crimp jacket and the connector housing.