



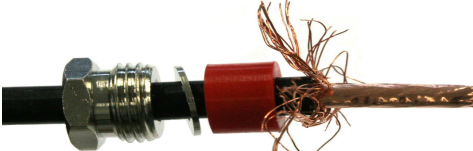





# Mounting instruction

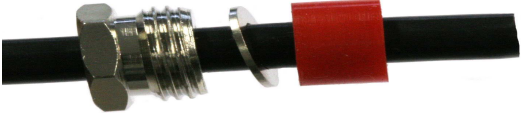

## AIRCELL®5

BNC-Angle Connector, screw/solder / Art. No. 7724

 <p><b>1.</b> Cut off cable tail right-angled. Move the nut, clamping ring and rubber washer over the cable head. Hint: With a bit of Vaseline the rubber seal can be slid easier over the outer sheath</p>	 <p><b>5.</b> Move the contact sleeve as far it goes between the copper braid and the foil.</p>
 <p><b>2.</b> Remove 14 mm of the outer sheathing with a knife.</p>	 <p><b>6.</b> Cut off the copper braid with a side cutter and move the rubber washer forward to the contact sleeve, so that the remaining braid is clamped between the rubber washer and the contact sleeve.</p>
 <p><b>3.</b> Bend copper braid upwards right-angled.</p>	 <p><b>7.</b> Insert the prepared cable end into the connector housing as far as it will go (Click). Solder the inner conductor to the middle contact.</p>
 <p><b>4.</b> Remove 4mm of the copper foil and 3mm of the foamed dielectric.</p>	 <p><b>8.</b> Take two open-end wrenches 11mm to tighten the clamping nut hand-tight and screw the cap firmly.</p>